


# CLIFF

## DISPLAYPORT CABLES



P1	Wiring Diagram	P2
1	Black	12
3	White	10
2	Grounding	11
4	Brown	9
6	White	7
5	Grounding	8
7	Red	6
9	White	4
8	Grounding	5
10	Green	3
12	White	1
11	Grounding	2
13	Yellow	13
14	Red	14
15	Blue	15
17	White	17
16	Grounding	16
18	Orange	18
19	White	19
20	Empty	20

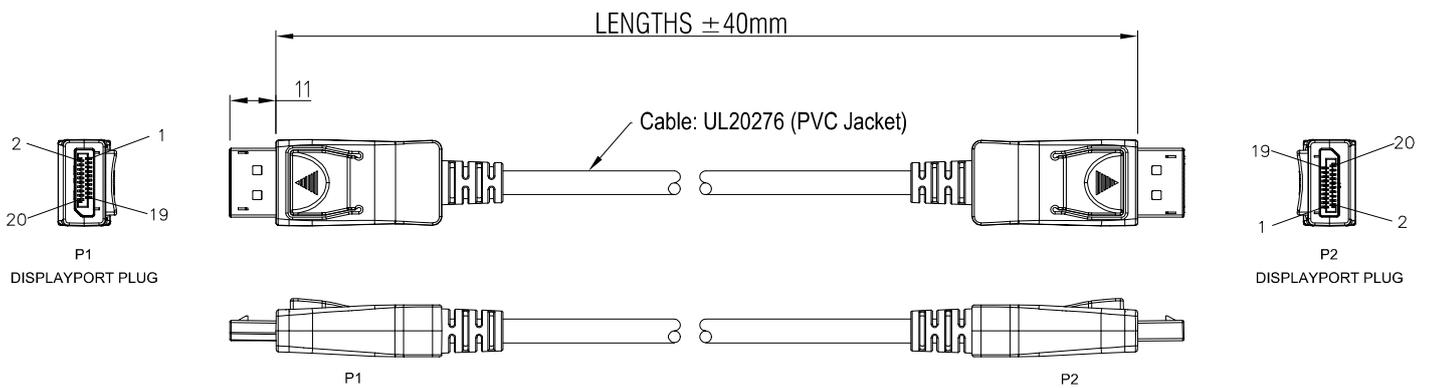

### NOTES:

- Supplied with dust caps
- Continuity conductor Resistance: 3Ω MAX
- Insulation Resistance: 10MΩ MIN

### VARIANTS:


- FCR72010** - DisplayPort to DisplayPort 8K cable, 1m Black
- FCR72011** - DisplayPort to DisplayPort 8K cable, 2m Black



# DISPLAYPORT CABLES



P1	Wiring Diagram	P2
8	Grounding wire	1
12	White	3
10	Black	5
11	Grounding wire	7
9	White	9
7	Brown	11
2	Grounding wire	13
6	White	15
4	Red	17
19	Yellow	19
18	Orange	2
13	Red	4
14	White	6
5	Grounding wire	8
3	White	10
1	Green	12
16	Grounding wire	14
15	White	16
17	Blue	18
20	Empty	20

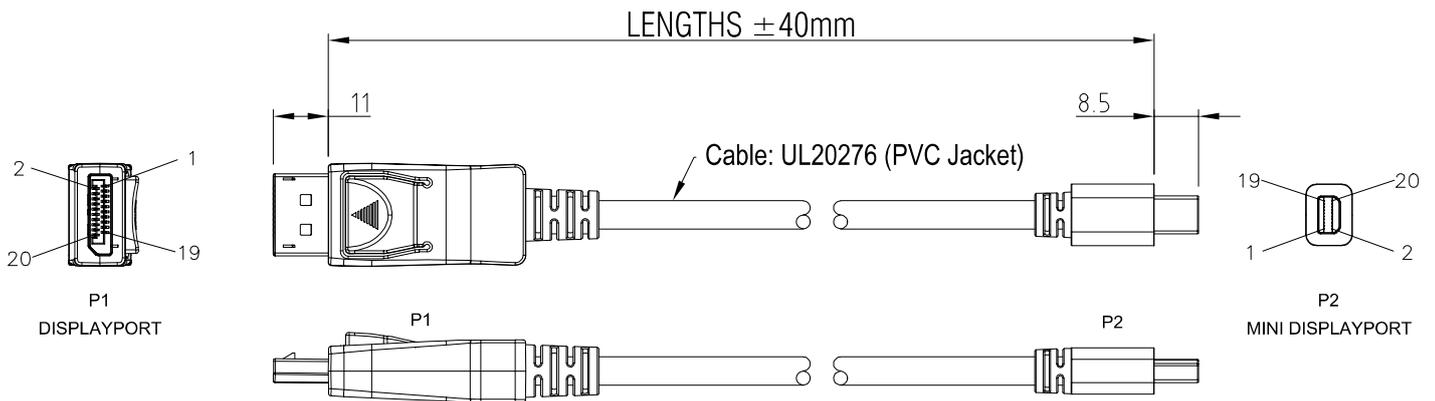

**NOTES:**

- Supplied with dust caps
- Continuity conductor Resistance: 3Ω MAX
- Insulation Resistance: 10MΩ MIN

**VARIANTS:**

- FCR72013** - DisplayPort to Mini DisplayPort 4K cable, 1m Black
- FCR72014** - DisplayPort to Mini DisplayPort 4K cable, 2m Black

